- 2-Quadrant Operation
- · Hall Sensor Feedback
- Constant Velocity Mode
- Single Input Speed and Direction Control (Auto-Direction)

MDC300-120301 - Brushless DC Controller


- Short Circuit Protection
- Requires 85-135VAC
- Speed Out and Fault Out
- · Run/Stop, Freewheel and Direction Inputs
- Optically Isolated Inputs and Outputs
- Dual Mounting Option
- Detachable, Screw Type Terminal Blocks
- Covered, Screw Type Strips for the Power Inputs and Motor **Phases**






The MDC300-120301 driver is designed to drive DC brushless motors at currents up to 30A and 170VDC. Using hall sensor feedback, a constant velocity mode can be selected. The driver is protected against over current (cycle-by-cycle or latched), hall sensor error and under voltage. When an error occurs, a fault light notifies the user. If the fault latch is enabled and an error occurs, the fault output goes low to notify the user. Included on the driver is and internal potentiometer to control the maximum phase current allowed into the motor and an internal potentiometer to control the speed of the motor. An optional external potentiometer or voltage input can be used to control the speed as well. The direction of the motor can be preset by the direction control input or controlled by the external voltage speed input. Other inputs to the drive include a run/stop and a motor freewheel input. An onboard potentiometer sets the ramp up/down profile from standstill. The run/stop input overrides all other inputs into the driver.



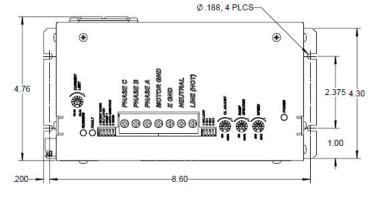

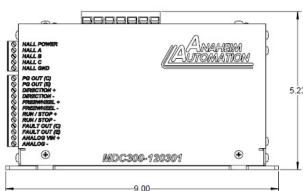

L011126



Control Isolated Inputs: (TB1, Pins 3-8,11,12)

1mA minimum Logic "0" = 4-7VDC Logic "1" = Open

Power Requirements: 85VAC (min) - 135VAC (max)

Output Current Range: 10.0 - 30.0 Amps (peak)
5.0 - 15.0 Amps (Continuous)

Hall Sensor Power Output: 5V @ 30mA (Max)

Operating Temperature: Heat Sink: 0°-70°

Control Isolated Outputs: (TB1, Pins 1,2,9,10)

These open collector outputs are able to sink 50mA.

An open collector signal pulse out is available at a rate of 4 pulses for 1 revolution of an 8-pole motor, 3 pulses for 1 revolution of a 6-pole motor, and 2 pulses for 1 revolution of a 4-pole motor.

(TB1, Pin 1-2)

8-pole motor RPM = 15 \* PG OUT (in Hz)
6-pole motor RPM = 20 \* PG OUT (in Hz)
4-pole motor RPM = 30 \* PG OUT (in Hz)

Fault Output:
(TB1, Pin 9-10)

When normal operation occurs, this output will conduct current into the emitter. Care must be taken to not pass more than 50mA of current through this transistor. The emitter is also optically isolated.

Output Current Rating: Adjustable 10.0-30.0 amperes per phase maximum operating peak current (5.0-15.0 amperes per phase maximum operating continuous current)

2 pole: 30,000 RPM

Maximum Closed Loop

Motor Speed

4 pole: 15,000 RPM

6 pole: 11,250 RPM

8 pole: 7,500 RPM

Maximum Open Loop Motor Speed 50,000 RPM

